

Date: Wednesday, 1/11/2006 4:10:22 PM
 User: Kim Johnston

Process Sheet

Customer : CU-DAR001 Dart Helicopters Services	Drawing Name : FLOAT STEP ASSEMBLY LH (206/407)
Job Number : 23320A	
Estimate Number : 11664	
P.O. Number : N/A	Part Number : D2842041
This Issue : 1/11/2006 S.O. No. : N/A	Drawing Number : D2841 REV B
Prsht Rev. : NC	Project Number : N/A
First Issue : N/A Type : LARGE FAB ASSY	Drawing Revision : B
Previous Run : 25434A	Material : N/A
Written By : <u>SEE COMMENT BELOW</u>	Due Date : 1/30/2006 Qty: 2 Um: Each
Checked & Approved By : <u>SEE ABOVE USE & DATE.</u>	
Comment : Est Rev:D As Per Ecn 766 06-01-06 JLM	

Additional Product

Job Number:



Seq. #:	Machine Or Operation:	Description :
----------------	------------------------------	----------------------

1.0	D2622120C	Extrusion
-----	-----------	-----------



Comment: Qty.: 1.0000 Each(s)/Unit Total: 2.0000 Each(s)

Qty	Part #	Description	Batch:
1	D2622-120C	Extrusion	<u>324092</u>

Check Material for any Dents or Defects

h.e. 06-02-6 = 2

2.0	LARGE FAB 1	LARGE FABRICATION RESOURCE 1
-----	-------------	------------------------------

**Comment:** LARGE FABRICATION RESOURCE 1

1-Cut D2842-1 using D2622 extrusion as per Dwg D2842

2-Drill D2842-1 using Jig DT8271 as per Dwg D2842

3-Deburr and bevel ends for welding

h.e. 06-02-6 = 2

h.e. 06-02-7 = 2

h.e. 06-02-7 = 2

3.0	D2734	206 Step Endplate
-----	-------	-------------------

**Comment:** Qty.: 2.0000 Each(s)/Unit Total: 4.0000 Each(s)

206 Step Endplate

Pick:

Qty	Part Number	Description	Batch
2	D2734	End Cap	<u>320757</u>

h.e. 06-02-8 = 2

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Wednesday, 1/11/2006 4:10:23 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: FLOAT STEP ASSEMBLY LH (206/407)

Job Number: 23320A

Part Number: D2842041

Job Number:



Seq. #:

Machine Or Operation:

Description :

4.0

D2776

Step Lug



Comment: Qty.: 2.0000 Each(s)/Unit Total: 4.0000 Each(s)

Step Lug

Pick:

Qty Part Number Description Batch

2 D2776 Lug

Qty	Part #	Descr.	batch
2	D3459-3	Lug	325430
2	D3459-1	Lug	325429

5.0

LARGE FAB 1

LARGE FABRICATION RESOURCE 1



Comment: LARGE FABRICATION RESOURCE 1

1-Weld one end cap and (2) lugs using Jig DT followed by DT as per Dwg D2842
A/R AL Rod Batch: M18839

2-Grind end cap weld flush

FF. 06.02.8 = 2

FF. 06.02.08 2

6.0

QC5/9

WELD INSPECTION



Comment: WELD INSPECTION

7.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Chemical Conversion Coat as per QSI 005 4.1

A.M. 06-02-28

8.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

9.0

LARGE FAB 1

LARGE FABRICATION RESOURCE 1



Comment: LARGE FABRICATION RESOURCE 1

1-Remove alodine prior to welding.

Weld end cap as per Dwg D2842.

A/R AL Rod Batch: 324402 = 1pc B20757 = 1pc

→ M18838

FF. 06.03.2 2

PTD on next page.

FF. 06.02.8 = 2

06.02.27
06/02/27

06.03.01 2

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Wednesday, 1/11/2006 4:10:23 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: FLOAT STEP ASSEMBLY LH (206/407)

Job Number: 23320A

Part Number: D2842041

Job Number:



Seq. #:

Machine Or Operation:

Description :

2-Grind end cap weld flush.

FC 06.03.02 2

10.0

QC5/9

WELD INSPECTION



Comment: WELD INSPECTION

PD 06-03-02 2

11.0

POWDER COATING

POWDER COATING



Comment: POWDER COATING

Touch up Alodine end cap and Powder Coat Gloss White (Ref: 4.3.5.1) as per QSI 005 4.3

A. m 06-03-07

12.0

NAS1329C3KB130

insert



Comment: Qty.: 3.0000 Each(s)/Unit Total : 6.0000 Each(s)

Insert

Pick:

Qty Part Number

Description Batch

3

NAS1329C3KB130Insert

m100034

FC

13.0

MS27039C107

screw



Comment: Qty.: 3.0000 Each(s)/Unit Total : 6.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

3

MS27039C1-07

Screw

m19522

FC

14.0

NAS1515H3L

WASHER



Comment: Qty.: 3.0000 Each(s)/Unit Total : 6.0000 Each(s)

Pick:

Qty Part Number

Description Batch

3

NAS1515H3L

WASHER

m19185

FC

15.0

AN960C10L

washer



Comment: Qty.: 3.0000 Each(s)/Unit Total : 6.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

3

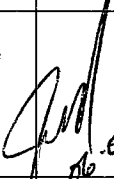


 
 
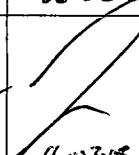
AN960C10L

WASHER

m18822

FC 06 03 10

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector	
06.02.27	4	- correct style of logs and Qty as per Dwg. - change has been made.		06.02.27		 06.02.27	 06.02.27	
06.03.08	2	- CHANGE DRILL SIZE FOR HOLES TO 'E' INSTEAD OF Q	 06.03.08			 06.03.08	 06.03.08	

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes ☐ No ☒ DQA: *[Signature]* Date: 06/03/13
 QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			
06.02.22	8	Ends of steps bent inwards due to welding the logs to list, and the heat pulled the ends of the step in.	<i>[Signature]</i> 06.02.22	Steps are acceptable. weld 1 log at a time, and let parts cool between welds.	<i>[Signature]</i> 06.02.27	<i>[Signature]</i> 06.02.22	<i>[Signature]</i> 06.02.22	<i>[Signature]</i> 06.02.22
06.02.22	2	Hole drilled on both sides of steps. Hole only to be on one side.	<i>[Signature]</i> 06.02.22	Fill holes with the weld and grind flush as per qs 1004. See attached e-mail.	<i>[Signature]</i> 06.02.27	<i>[Signature]</i> 06.02.25	<i>[Signature]</i> 06.02.22	<i>[Signature]</i> 06.02.22

NOTE: Date & initial all entries

Date: Wednesday, 1/11/2006 4:10:23 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: FLOAT STEP ASSEMBLY LH (206/407)

Job Number: 23320A

Part Number: D2842041

Job Number:



Seq. #:

Machine Or Operation:

Description :

16.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: LARGE FABRICATION RESOURCE 1

1-Install inserts as per Dwg D2842

2-Wing Walk as per Dwg D2842 and QSI 005 4.1

Batch: M100037

QSI 06-03-08

17.0

QC3/5

INSPECT WORK/WING WALK



Comment: INSPECT WORK/WING WALK

ml 06 03 08

18.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Identify and Stock

Location: ✓

CY 06/03/09

19.0

DC

DOCUMENT CONTROL



Comment: DOCUMENT CONTROL

Inspection Level 21

06/03/13

Job Completion



u 06-03-10

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

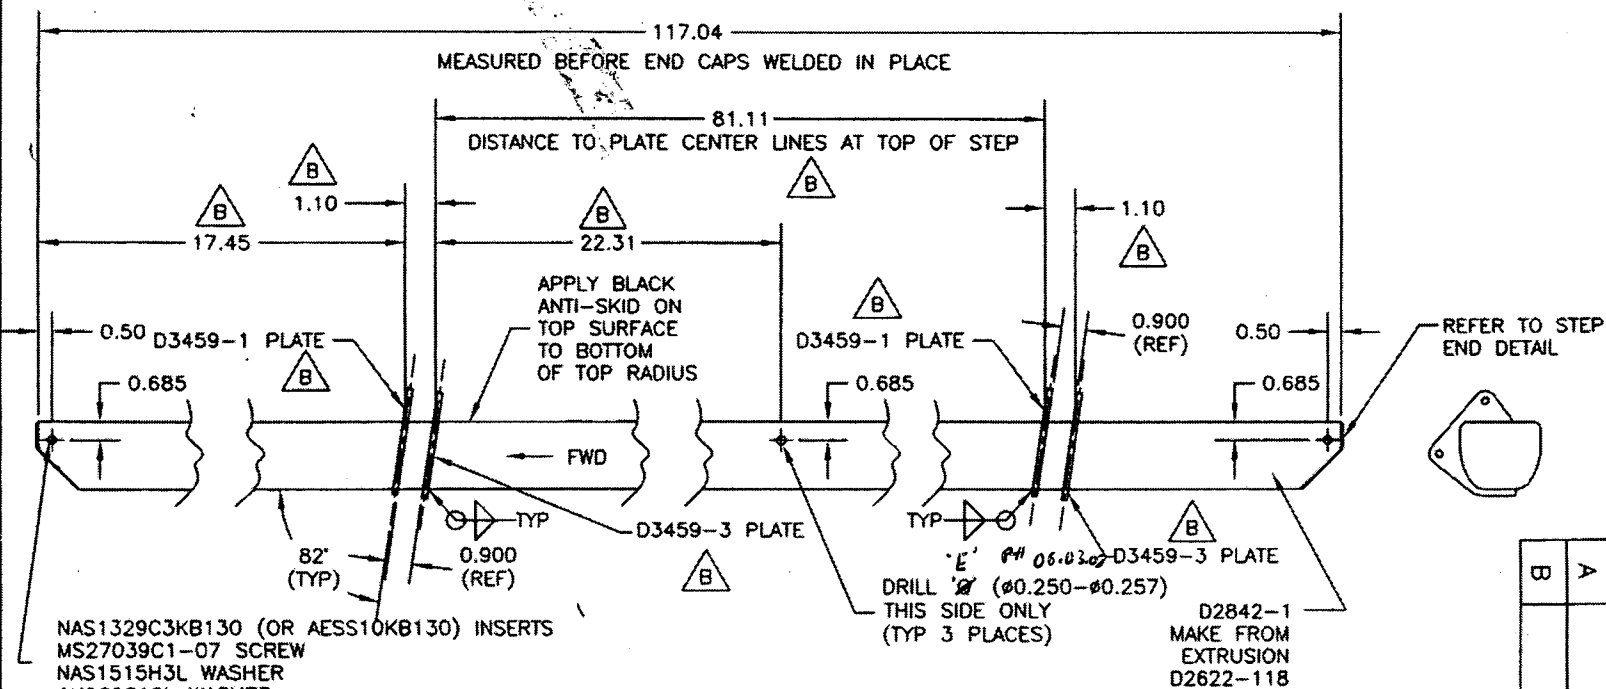
QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries



DESIGN	KE	DRAWN BY	PH	DART AEROSPACE USA, INC.
CHECKED		APPROVED		PORT HADLOCK, WA
DATE	05.09.23	DRAWING NO.	D2842	REV. B
		TITLE	206L/407 FLOAT STEP ASSEMBLY	SHEET 1 OF 1
			NEW ISSUE	SCALE
			RE-DESIGN, ADD D3459-1/-3	MTS

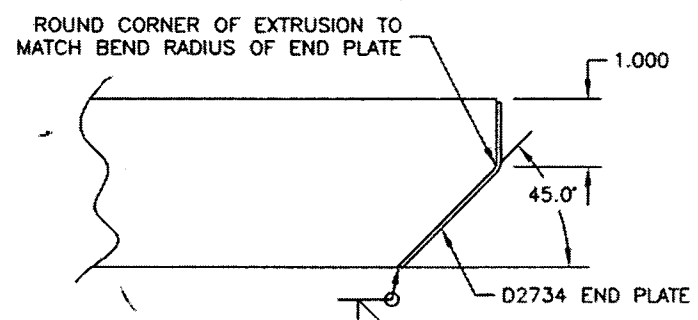


NAS1329C3KB130 (OR AESS10KB130) INSERTS
MS27039C1-07 SCREW
NAS1515H3L WASHER
AN960C10L WASHER
(TYP 3 PLACES)

D2842-041 LH STEP ASSEMBLY (SHOWN)
D2842-042 RH STEP ASSEMBLY (OPPOSITE)

D2842-041/-042 FLOAT STEP ASSEMBLY PARTS LIST

QTY	QTY	PART NUMBER	DESCRIPTION
-041	-042		
X		D2842-041	LH STEP ASSEMBLY
	X	D2842-042	RH STEP ASSEMBLY
1	1	D2622-118	EXTRUSION
2	2	D2734	END PLATE
2	2	D3459-1	PLATE
2	2	D3459-3	PLATE
3	3	NAS1329C3KB130 (OR AESS10KB130)	INSERT
3	3	MS27039C1-07	SCREW
3	3	NAS1515H3L	WASHER
3	3	AN960C10L	WASHER



TYPICAL STEP END DETAIL
NOT TO SCALE

REFERENCE ONLY

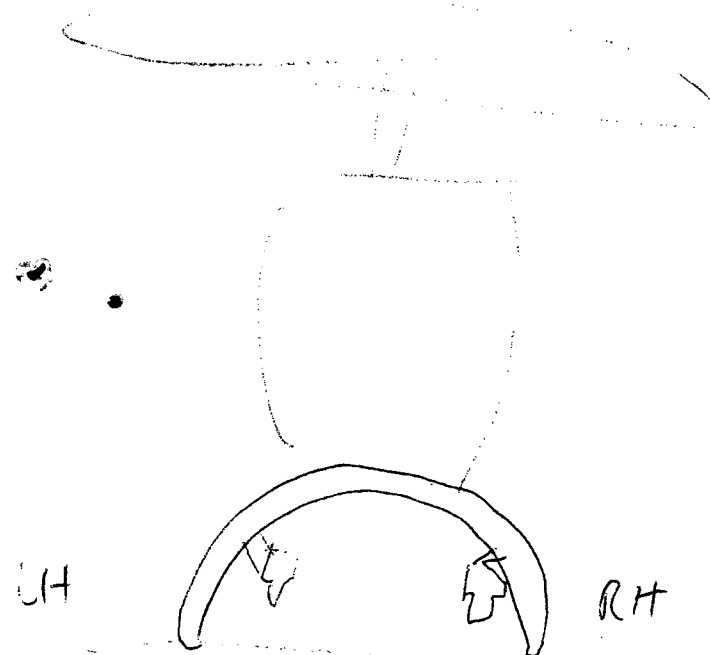
D2842-041/-042 FLOAT STEP ASSEMBLY

- 1) MAKE FROM EXTRUSION D2622
- 2) WELD PER DART QSI 004
- 3) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
POWDER COAT ASSEMBLY WHITE (4.3.5.1) PER DART QSI 005 4.3
APPLY BLACK ANTI-SKID PAINT PER DART QSI 005 4.4
- 4) ALL DIMENSIONS ARE IN INCHES
- 5) ALL TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED

RELEASED
05.11.14

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

Copyright © 2005 by DART AEROSPACE USA, INC.



Jason Murdoch

From: David Shepherd [davids@dartaero.com]
Sent: February 22, 2006 11:05 AM
To: Jason Murdoch
Subject: Re: new 206 step welding

The steps that bent during welding are acceptable. With respect to the #30 holes that were drilled on the wrong side of the step, fill them with weld per QSI 004 and grind flush.

David

----- Original Message -----

From: "Jason Murdoch" <jmurdoch@dartaero.com>
To: "'David Shepherd'" <davids@dartaero.com>
Sent: Wednesday, February 22, 2006 8:35 AM
Subject: RE: new 206 step welding

> Hi. Are these float steps acceptable from what you saw as is? Next time we
> will weld them with not so much heat in one location. One lug plate at a
> time. Also is it ok to fill the holes that were drilled on the opposite
side
> and grind flush? The holes are #30 luckily so they are tiny to fill in.

>
> jmurdoch@dartaero.com
> Q.C.Inspector
> -----Original Message-----
> From: David Shepherd [mailto:davids@dartaero.com]
> Sent: February 15, 2006 3:17 AM
> To: Peter Hum
> Cc: Jason Murdoch (E-mail); Bill Beckett
> Subject: Re: new 206 step welding

>
> Peter,
>
> Your 206 step design is very similar to the 119 design and we don't have
> this problem on 119 that I know of.
> I would compare the 206 step welding fixture to the 119 welding fixture.
Is
> it possible that the 206 jig isn't restricting the step
> from moving on you? Does the welder have to move around from front to
back?

>
> David

>
> ----- Original Message -----
> From: "Peter Hum" <phum@dartaero.com>
> To: "David Shepherd (E-mail)" <davids@dartaero.com>
> Cc: "Jason Murdoch (E-mail)" <jmurdoch@dartaero.com>
> Sent: Tuesday, February 14, 2006 6:06 AM
> Subject: new 206 step welding

>
>
> > Hi David,
> >
> > In welding the new 206 step lugs, there has been some bending of the
step
> > due the heat of the weld. Between the lugs the step is straight. Between
> the
> > lugs and the ends (short distance), the step bends as shown in the
picture.
> >
> > What should we do?
> >

> > 1) Is it allowable to reheat the step in order to bend the step into a
> > straight position?
> > 2) Leave as is?
> > 3) Scrap and rethink weld technique?
> >
> > Thanks
> > Peter
> >
> >
>
>